# Current Monitoring







#### HAZARD OF ELECTRIC SHOCK, EXPLOSION, OR ARC FLASH

- Follow safe electrical work practices. See NFPA 70E in the USA, or applicable local code
- This equipment must only be installed and serviced by qualified electrical personne Read, understand and follow the instructions before installing this product.
- Turn off all power supplying equipment before working on or inside the equipment.
- Use a properly rated voltage sensing device to confirm power is off.
- DO NOT DEPEND ON THIS PRODUCT FOR VOLTAGE INDICATION
- Only install this product on insulated conductors.

#### Failure to follow these instructions will result in death or serious injur

A qualified person is one who has skills and knowledge related to the construction and operation of this electrical equipment and the installation, and has received safety training to recognize and avoid the hazards involved. NEC2011 Article 100

No responsibility is assumed by Veris Industries for any consequences arising out of the use of this material.

#### NOTICE

- This product is not intended for life or safety applications.
- Do not install this product in hazardous or classified locations. The installer is responsible for conformance to all applicable code
- Mount this product inside a suitable fire and electrical enclosure

# • Hawkeye M

# H952

Split-Core Current Transducer with Relay, 0-5 VDC Output

### Product Overview


The H952 is a current-sensitive device that monitors current (amperage) in any of three field-selectable ranges; 0-30, 0-60, or 0-120 amperes. These ranges represent the maximum current that can be applied to the monitored conductor. The H952 transforms the monitored current into a 0-5 VDC output suitable for connection to building controllers or other appropriate data acquisition equipment. It is also equipped with a command relay.

The H952 housing offers unprecedented mounting flexibility. The mounting bracket can be attached in three different places. Additionally, the bracket is compatible with the Veris AHO1 DIN Rail clip, allowing DIN mounting.

### Specifications

Sensor Power	Induced from monitored conductor
Amperage Range	0 to 30/60/120 A (selectable)
Insulation Class	600VAC RMS
Relay	SPST, N.O., 12VDC
Frequency Range	50/60 Hz
Temperature Range	-15° to 60°C (5° to 140°F)
Humidity Range	10 - 90% RH, non-condensing
Accuracy	±2% full scale from 10% to 100% (selected range)
Response Time	2 sec.
Terminal Block Wire Size	24-14 AWG (0.2 to 2.1 mm²)
Terminal Block Torque	3.5 to 4.4 in-lbs (0.4 to 0.5 N-m)
Agency Approvals	UL 508 open device listing

#### **Dimensions**

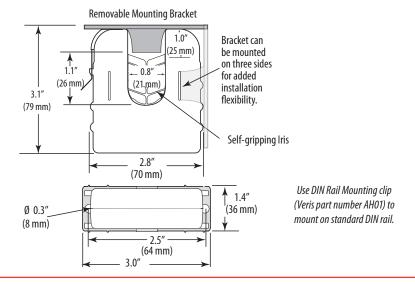




### Installation

# Disconnect and lock out power to the enclosure containing the conductor to be


- 1. Locate a mounting surface for the removable mounting bracket that will allow the monitored conductor to pass through the center window when it is installed and that will keep the product at least ½" (13 mm) from any uninsulated conductors. Determine cable routing for the controller connection, allowing wiring to reach the mounting location.
- 2. Drill holes to mount the bracket to the chosen surface using the included screws.
- 3. Set the desired amperage range (30, 60, or 120 Amps).
- 4. Wire the output connections between the sensor and the controller (0-5 VDC).
- 5. Snap the sensor over the wire to be monitored and clip the assembly to the mounting bracket.
- 6. Scale the controller software to match the sensor's output.
- 7. Secure the enclosure and reconnect power.

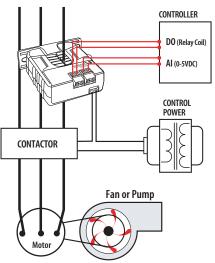

#### Notes

#### For load currents greater than sensor maximum rating:


Use a 5 Amp (H68xx series) current transformer (CT) as shown. This technique can be combined with wrapping (see below) to add range for a low current load on a high current source.

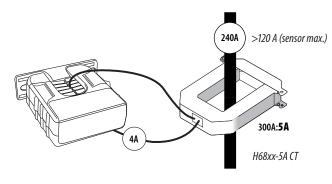

**DANGER: 5A CTs can present** hazardous voltages. Install CTs in accordance with manufacturer's instructions. **Terminate the CT secondary** before applying current.

#### For load currents less than sensor minimum rating:

Wrap the monitored conductor through the center window and around the sensor body to produce multiple turns. This increases the current measured by the transducer. Program the controller to account for the extra turns (e.g., if four turns pass through the sensor (as shown), divide the normal reading by 4).

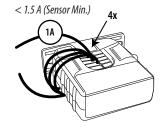

#### **CAUTION**

**RISK OF EQUIPMENT DAMAGE** 


Derate the product's maximum current for the number of turns through the sensing window using the following formula.

Rated Max. Amps + Number of Turns = Max. monitored Amps e.g.: 100A ÷ 4 Turns = 25 Amps max. in monitored conductor

Failure to follow these instructions can result in overheating and permanent equipment damage.



## Wiring

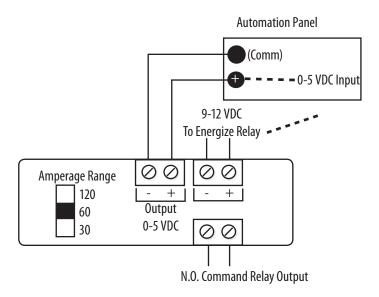

### Relay Information

RELAY CONTACT RATINGS (N.O.)		
Resistive 5A@240VAC		
5A@30VDC		
Inductive 2A@240VAC 2A@30VDC		
TYPICAL COIL PERFORMANCE		
Voltage AC	DC	
24 15mA	15mA	
12		
	20mA	
12 Pull In Voltage	20mA 8.4VDC	

## Scaling

